#Test 'LTO Drive Assessment test' started on device 'HP Ultrium 3-SCSI' at address '3/0.11.0' -Test Incomplete **∄** Operations Log É-Analysis Results -LTO Drive Assessment Test, version V01.09.2010 Test run: Mon Nov 1 14:36:52 2010 -Drive serial number: HUE0937PKA -Data Cartridge Information: Vendor: IMATION Format: LTO-3 Serial Number: 0D39892540 Barcode: SLOT0004 The drive is currently requesting cleaning. ANALYSIS OF HISTORICAL INFORMATION (from drive logs): version: V14.09.2010 Firmware rev D24W is up-to-date for Ultrium 3-SCSI as of Thu Apr 8 19:00:00 2010. Rule 19: The drive logs indicate that this drive needs cleaning.
Please clean the drive with an unexpired cleaning tape. The drive is experiencing polling (1.0 / second polling rate) on initiator ID 7. This could be due to RSM or it could be due to another host.
Polling can interrupt the normal operation of the drive, and significantly reduce performance. There were 18 rules checked. Device Analysis has checked the historical information and warnings have been reported. RESULTS OF TESTS ON THIS DRIVE [Please note: the operations performed by this overwrite test will NOT be reflected in the Support Ticket usage/health information.] Amount of data required' test option : Default The Short Erase operation failed to complete. Byte2 0x3 SenseCode 0xc SenseQual 0x0 (Write error) ErrorCode 0x5083 The Short Erase operation failed to complete. -Byte2 0x3 SenseCode 0xc SenseQual 0x0 (Write error) ErrorCode 0x5083 The LTO Drive Assessment Test has checked the history and/or operation of the selected drive, and

Please re-run the test using a different test tape.
The results of this test cannot be guaranteed.
Please run the test with the default options to check the operation of your drive.

Some problems were found that could be due to the test tape, but the test was not run using the default test options.