


Test 'LTO Drive Assessment test' started on device 'HP Ultrium 3-SCSI' at address '3/0.4.0'  
 -This test will overwrite all the data on this tape. Would you like to continue the test?  
 Operations Log  
 Analysis Results  
 -LTO Drive Assessment Test, version V10.08.2011  
 -Test run: Wed Oct 19 14:19:01 2011  
 -Drive serial number: HU10732414  
 -Data Cartridge Information:  
   Vendor: HP  
   Format: LTO-3  
   Serial Number: 2250336052  
   Barcode: SLOT0004  
 -ANALYSIS OF HISTORICAL INFORMATION (from drive logs):  
   -version: V02.06.2011  
   -Firmware rev D24W is up-to-date for Ultrium 3-SCSI as of Thu Apr 8 19:00:00 2010.  
 -Rule 4.0 (Write/Errors reported):  
   -There were unrecoverable write errors while writing tape 2250336052 (SLOT0004).  
   -The drive write/read performance is sub-optimal on 2 channels.  
   -Please use an unexpired cleaning tape on the drive.  
   -Then try using another tape.  
 -Rule 5.0 (Read/Errors reported):  
   -There were unrecoverable read errors while reading tape 2250336052 (SLOT0004).  
   -The drive write/read performance is sub-optimal on 1 channels.  
   -Please use an unexpired cleaning tape on the drive.  
   -Then try using another tape.  
 -Rule 8.12 (Cartridge Memory/Missing or unreadable barcode):  
   -One or more cartridge has missing/unreadable barcode.  
   -hp recommends the use of hp storage media.  
 -There were 18 rules and 114 subrules checked.  
   -Device Analysis has checked the historical information and warnings have been reported.  
 -Results of tests on this drive:  
   -[Please note: the operations performed by this overwrite test will NOT be reflected in the Support Ticket usage/health information.]  
   - The Short Erase operation failed to complete.  
   -Byte2 0x3 SenseCode 0xc SenseQual 0x0 (Write error) ErrorCode 0x5083  
   -Overall drive margin: 0.0%  
   -Worst-case margin: 100.0%  
   -Worst-case channel variation margin: 100.0%  
   -Test time: 11:39  
   -Test aborted